


NDX.Q Square Terminal Elements

NDX.Q Square Terminal Elements

NDX.Q square terminal elements with polyamide-based technopolymer reinforced with glass fiber. Resistant to solvents, oils, greases and other chemical agents.

[Catalog access](#)

Image not found or type unknown

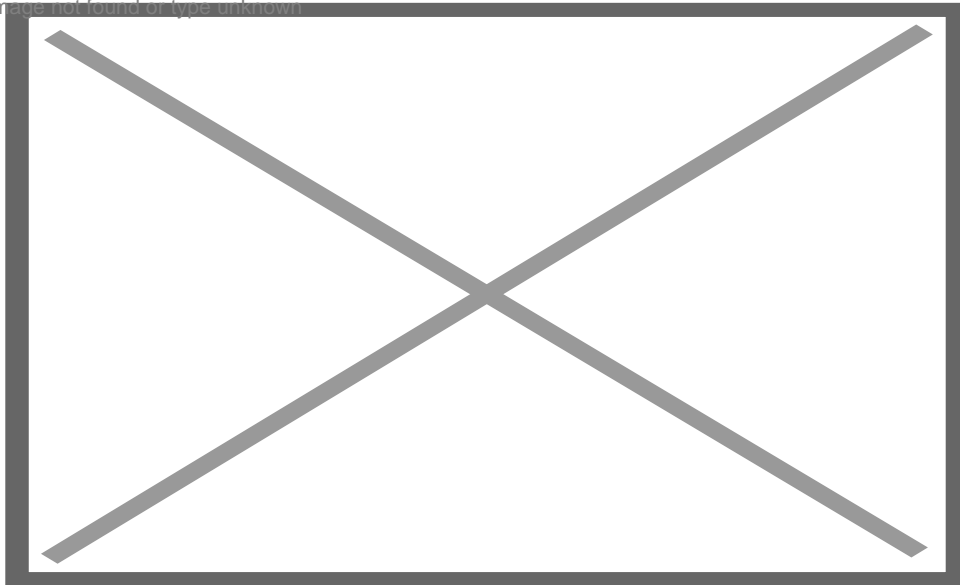

Technical information

| Elementos standard | | | Dimensiones principales | | | | Agujero de montaje | Dimensiones del tubo | | | * Carga estática límite máx | Peso | |
|--------------------|--------|-----------------|-------------------------|----|----|----|--------------------|----------------------|---------|--------|-----------------------------|------|----|
| Código | Código | Descripción | L | H | h1 | I | d | h | Externo | Grosor | Interno | [N] | g |
| | 320011 | NDX.Q-20x1.5-M8 | 20 | 23 | 5 | 17 | M8 | 10 | 20 | 1.5 | 17 | 4000 | 13 |

| | | | | | | | | | | | | | |
|-------------|--------|------------------|----|----|---|----|-----|----|----|-----|----|------|----|
| | 320021 | NDX.Q-25x1.5-M8 | 25 | 26 | 6 | 22 | M8 | 10 | 25 | 1.5 | 22 | 4500 | 20 |
| | 320022 | NDX.Q-25x1.5-M10 | 25 | 26 | 6 | 22 | M10 | 10 | 25 | 1.5 | 22 | 4500 | 20 |
| | 320023 | NDX.Q-25x1.5-M12 | 25 | 26 | 6 | 22 | M12 | 10 | 25 | 1.5 | 22 | 4500 | 20 |
| | 320031 | NDX.Q-30x1.5-M8 | 30 | 31 | 6 | 27 | M8 | 10 | 30 | 1.5 | 27 | 4500 | 28 |
| 44310320032 | 320032 | NDX.Q-30x1.5-M10 | 30 | 31 | 6 | 27 | M10 | 10 | 30 | 1.5 | 27 | 4500 | 28 |
| | 320033 | NDX.Q-30x1.5-M12 | 30 | 31 | 6 | 27 | M12 | 10 | 30 | 1.5 | 27 | 4500 | 28 |
| | 320034 | NDX.Q-30x1.5-M14 | 30 | 31 | 6 | 27 | M14 | 15 | 30 | 1.5 | 27 | 4500 | 30 |
| | 320035 | NDX.Q-30x1.5-M16 | 30 | 31 | 6 | 27 | M16 | 15 | 30 | 1.5 | 27 | 4500 | 30 |
| | 320041 | NDX.Q-30x2.0-M8 | 30 | 31 | 6 | 26 | M8 | 10 | 30 | 2 | 26 | 4500 | 28 |
| | 320042 | NDX.Q-30x2.0-M10 | 30 | 31 | 6 | 26 | M10 | 10 | 30 | 2 | 26 | 4500 | 28 |
| | 320043 | NDX.Q-30x2.0-M12 | 30 | 31 | 6 | 26 | M12 | 10 | 30 | 2 | 26 | 4500 | 28 |
| | 320044 | NDX.Q-30x2.0-M14 | 30 | 31 | 6 | 26 | M14 | 15 | 30 | 2 | 26 | 4500 | 30 |
| | 320045 | NDX.Q-30x2.0-M16 | 30 | 31 | 6 | 26 | M16 | 15 | 30 | 2 | 26 | 4500 | 30 |
| | 320051 | NDX.Q-35x1.5-M8 | 35 | 38 | 8 | 32 | M8 | 10 | 35 | 1.5 | 32 | 6000 | 40 |
| 44310320052 | 320052 | NDX.Q-35x1.5-M10 | 35 | 38 | 8 | 32 | M10 | 10 | 35 | 1.5 | 32 | 6000 | 40 |
| | 320053 | NDX.Q-35x1.5-M12 | 35 | 38 | 8 | 32 | M12 | 10 | 35 | 1.5 | 32 | 6000 | 40 |
| | 320054 | NDX.Q-35x1.5-M14 | 35 | 38 | 8 | 32 | M14 | 15 | 35 | 1.5 | 32 | 6000 | 42 |
| | 320055 | NDX.Q-35x1.5-M16 | 35 | 38 | 8 | 32 | M16 | 15 | 35 | 1.5 | 32 | 6000 | 42 |
| | 320056 | NDX.Q-35x1.5-M20 | 35 | 38 | 8 | 32 | M20 | 20 | 35 | 1.5 | 32 | 6000 | 41 |
| | 320061 | NDX.Q-35x2-M8 | 35 | 38 | 8 | 31 | M8 | 10 | 35 | 2 | 31 | 6000 | 40 |
| | 320062 | NDX.Q-35x2-M10 | 35 | 38 | 8 | 31 | M10 | 10 | 35 | 2 | 31 | 6000 | 40 |
| | 320063 | NDX.Q-35x2-M12 | 35 | 38 | 8 | 31 | M12 | 10 | 35 | 2 | 31 | 6000 | 40 |
| | 320064 | NDX.Q-35x2-M14 | 35 | 38 | 8 | 31 | M14 | 15 | 35 | 2 | 31 | 6000 | 42 |
| | 320065 | NDX.Q-35x2-M16 | 35 | 38 | 8 | 31 | M16 | 15 | 35 | 2 | 31 | 6000 | 42 |
| | 320066 | NDX.Q-35x2-M20 | 35 | 38 | 8 | 31 | M20 | 20 | 35 | 2 | 31 | 6000 | 40 |

| | | | | | | | | | | | | | |
|-------------|--------|------------------|----|----|----|------|-----|----|----|-----|------|------|----|
| | 320071 | NDX.Q-40x1.2-M8 | 40 | 38 | 8 | 37.6 | M8 | 10 | 40 | 1.2 | 37.6 | 6000 | 47 |
| | 320072 | NDX.Q-40x1.2-M10 | 40 | 38 | 8 | 37.6 | M10 | 10 | 40 | 1.2 | 37.6 | 6000 | 47 |
| | 320073 | NDX.Q-40x1.2-M12 | 40 | 38 | 8 | 37.6 | M12 | 10 | 40 | 1.2 | 37.6 | 6000 | 47 |
| | 320074 | NDX.Q-40x1.2-M14 | 40 | 38 | 8 | 37.6 | M14 | 15 | 40 | 1.2 | 37.6 | 6000 | 49 |
| | 320075 | NDX.Q-40x1.2-M16 | 40 | 38 | 8 | 37.6 | M16 | 15 | 40 | 1.2 | 37.6 | 6000 | 49 |
| | 320076 | NDX.Q-40x1.2-M20 | 40 | 38 | 8 | 37.6 | M20 | 20 | 40 | 1.2 | 37.6 | 8000 | 48 |
| | 320081 | NDX.Q-40x1.5-M8 | 40 | 38 | 8 | 37 | M8 | 10 | 40 | 1.5 | 37 | 6000 | 47 |
| 44310320082 | 320082 | NDX.Q-40x1.5-M10 | 40 | 38 | 8 | 37 | M10 | 10 | 40 | 1.5 | 37 | 6000 | 47 |
| 44310320083 | 320083 | NDX.Q-40x1.5-M12 | 40 | 38 | 8 | 37 | M12 | 10 | 40 | 1.5 | 37 | 6000 | 47 |
| | 320084 | NDX.Q-40x1.5-M14 | 40 | 38 | 8 | 37 | M14 | 15 | 40 | 1.5 | 37 | 6000 | 49 |
| 44310320085 | 320085 | NDX.Q-40x1.5-M16 | 40 | 38 | 8 | 37 | M16 | 15 | 40 | 1.5 | 37 | 6000 | 49 |
| | 320086 | NDX.Q-40x1.5-M20 | 40 | 38 | 8 | 37 | M20 | 20 | 40 | 1.5 | 37 | 8000 | 48 |
| | 320091 | NDX.Q-40x2-M8 | 40 | 38 | 8 | 36 | M8 | 10 | 40 | 2 | 36 | 6000 | 47 |
| | 320092 | NDX.Q-40x2-M10 | 40 | 38 | 8 | 36 | M10 | 10 | 40 | 2 | 36 | 6000 | 47 |
| | 320093 | NDX.Q-40x2-M12 | 40 | 38 | 8 | 36 | M12 | 10 | 40 | 2 | 36 | 6000 | 47 |
| | 320094 | NDX.Q-40x2-M14 | 40 | 38 | 8 | 36 | M14 | 15 | 40 | 2 | 36 | 6000 | 49 |
| | 320095 | NDX.Q-40x2-M16 | 40 | 38 | 8 | 36 | M16 | 15 | 40 | 2 | 36 | 6000 | 49 |
| | 320096 | NDX.Q-40x2-M20 | 40 | 38 | 8 | 36 | M20 | 20 | 40 | 2 | 36 | 8000 | 48 |
| | 320101 | NDX.Q-40x2.5-M8 | 40 | 38 | 8 | 35 | M8 | 10 | 40 | 2.5 | 35 | 6000 | 47 |
| | 320102 | NDX.Q-40x2.5-M10 | 40 | 38 | 8 | 35 | M10 | 10 | 40 | 2.5 | 35 | 6000 | 47 |
| | 320103 | NDX.Q-40x2.5-M12 | 40 | 38 | 8 | 35 | M12 | 10 | 40 | 2.5 | 35 | 6000 | 47 |
| | 320104 | NDX.Q-40x2.5-M14 | 40 | 38 | 8 | 35 | M14 | 15 | 40 | 2.5 | 35 | 6000 | 49 |
| | 320105 | NDX.Q-40x2.5-M16 | 40 | 38 | 8 | 35 | M16 | 15 | 40 | 2.5 | 35 | 6000 | 49 |
| | 320106 | NDX.Q-40x2.5-M20 | 40 | 38 | 8 | 35 | M20 | 20 | 40 | 2.5 | 35 | 8000 | 50 |
| | 320111 | NDX.Q-50x1.2-M8 | 50 | 45 | 10 | 47.6 | M8 | 10 | 50 | 1.2 | 47.6 | 6000 | 72 |

| | | | | | | | | | | | | |
|--------|------------------|----|----|--------|-----|-----|----|-----|------|------|------|----|
| 320112 | NDX.Q-50x1.2-M10 | 50 | 45 | 1047.6 | M10 | 10 | 50 | 1.2 | 47.6 | 6000 | 72 | |
| 320113 | NDX.Q-50x1.2-M12 | 50 | 45 | 1047.6 | M12 | 10 | 50 | 1.2 | 47.6 | 6000 | 72 | |
| 320114 | NDX.Q-50x1.2-M14 | 50 | 45 | 1047.6 | M14 | 15 | 50 | 1.2 | 47.6 | 6000 | 74 | |
| 320115 | NDX.Q-50x1.2-M16 | 50 | 45 | 1047.6 | M16 | 15 | 50 | 1.2 | 47.6 | 6000 | 74 | |
| 320116 | NDX.Q-50x1.2-M20 | 50 | 45 | 1047.6 | M20 | 20 | 50 | 1.2 | 47.6 | 8500 | 75 | |
| 320121 | NDX.Q-50x1.5-M8 | 50 | 45 | 10 | 47 | M8 | 10 | 50 | 1.5 | 47 | 6000 | 72 |
| 320122 | NDX.Q-50x1.5-M10 | 50 | 45 | 10 | 47 | M10 | 10 | 50 | 1.5 | 47 | 6000 | 72 |
| 320123 | NDX.Q-50x1.5-M12 | 50 | 45 | 10 | 47 | M12 | 10 | 50 | 1.5 | 47 | 6000 | 72 |
| 320124 | NDX.Q-50x1.5-M14 | 50 | 45 | 10 | 47 | M14 | 15 | 50 | 1.5 | 47 | 6000 | 74 |
| 320125 | NDX.Q-50x1.5-M16 | 50 | 45 | 10 | 47 | M16 | 15 | 50 | 1.5 | 47 | 6000 | 74 |
| 320126 | NDX.Q-50x1.5-M20 | 50 | 45 | 10 | 47 | M20 | 20 | 50 | 1.5 | 47 | 8500 | 75 |
| 320131 | NDX.Q-50x2-M8 | 50 | 45 | 10 | 46 | M8 | 10 | 50 | 2 | 46 | 6000 | 72 |
| 320132 | NDX.Q-50x2-M10 | 50 | 45 | 10 | 46 | M10 | 10 | 50 | 2 | 46 | 6000 | 72 |
| 320133 | NDX.Q-50x2-M12 | 50 | 45 | 10 | 46 | M12 | 10 | 50 | 2 | 46 | 6000 | 72 |
| 320134 | NDX.Q-50x2-M14 | 50 | 45 | 10 | 46 | M14 | 15 | 50 | 2 | 46 | 6000 | 74 |
| 320135 | NDX.Q-50x2-M16 | 50 | 45 | 10 | 46 | M16 | 15 | 50 | 2 | 46 | 6000 | 74 |
| 320136 | NDX.Q-50x2-M20 | 50 | 45 | 10 | 46 | M20 | 20 | 50 | 2 | 46 | 8500 | 75 |
| 320141 | NDX.Q-50x2.5-M8 | 50 | 45 | 10 | 45 | M8 | 10 | 50 | 2.5 | 45 | 6000 | 72 |
| 320142 | NDX.Q-50x2.5-M10 | 50 | 45 | 10 | 45 | M10 | 10 | 50 | 2.5 | 45 | 6000 | 72 |
| 320143 | NDX.Q-50x2.5-M12 | 50 | 45 | 10 | 45 | M12 | 10 | 50 | 2.5 | 45 | 6000 | 72 |
| 320144 | NDX.Q-50x2.5-M14 | 50 | 45 | 10 | 45 | M14 | 15 | 50 | 2.5 | 45 | 6000 | 74 |
| 320145 | NDX.Q-50x2.5-M16 | 50 | 45 | 10 | 45 | M16 | 15 | 50 | 2.5 | 45 | 6000 | 74 |
| 320146 | NDX.Q-50x2.5-M20 | 50 | 45 | 10 | 45 | M20 | 20 | 50 | 2.5 | 45 | 8500 | 74 |
| 320152 | NDX.Q-50x3.0-M10 | 50 | 45 | 10 | 44 | M10 | 10 | 50 | 3 | 44 | 6000 | 72 |
| 320153 | NDX.Q-50x3.0-M12 | 50 | 45 | 10 | 44 | M12 | 10 | 50 | 3 | 44 | 6000 | 72 |

| | | | | | | | | | | | | |
|--------|------------------|----|----|----|----|-----|----|----|---|----|------|----|
| 320154 | NDX.Q-50x3.0-M14 | 50 | 45 | 10 | 44 | M14 | 15 | 50 | 3 | 44 | 6000 | 74 |
| 320155 | NDX.Q-50x3.0-M16 | 50 | 45 | 10 | 44 | M16 | 15 | 50 | 3 | 44 | 6000 | 74 |
| 320156 | NDX.Q-50x3.0-M20 | 50 | 45 | 10 | 44 | M20 | 20 | 50 | 3 | 44 | 8500 | 75 |
| 320162 | NDX.Q-60x2.0-M10 | 60 | 45 | 10 | 56 | M10 | 10 | 60 | 2 | 56 | 6000 | 98 |
| 320163 | NDX.Q-60x2.0-M12 | 60 | 45 | 10 | 56 | M12 | 10 | 60 | 2 | 56 | 6000 | 98 |
| 320164 | NDX.Q-60x2.0-M14 | 60 | 45 | 10 | 56 | M14 | 15 | 60 | 2 | 56 | 6000 | 98 |
| 320165 | NDX.Q-60x2.0-M16 | 60 | 45 | 10 | 56 | M16 | 15 | 60 | 2 | 56 | 6000 | 97 |
| 320166 | NDX.Q-60x2.0-M20 | 60 | 45 | 10 | 56 | M20 | 20 | 60 | 2 | 56 | 8500 | 97 |
| 320172 | NDX.Q-60x3.0-M10 | 60 | 45 | 10 | 54 | M10 | 10 | 60 | 3 | 54 | 6000 | 98 |
| 320173 | NDX.Q-60x3.0-M12 | 60 | 45 | 10 | 54 | M12 | 10 | 60 | 3 | 54 | 6000 | 98 |
| 320174 | NDX.Q-60x3.0-M14 | 60 | 45 | 10 | 54 | M14 | 15 | 60 | 3 | 54 | 6000 | 98 |
| 320175 | NDX.Q-60x3.0-M16 | 60 | 45 | 10 | 54 | M16 | 15 | 60 | 3 | 54 | 6000 | 97 |
| 320176 | NDX.Q-60x3.0-M20 | 60 | 45 | 10 | 54 | M20 | 20 | 60 | 3 | 54 | 8500 | 97 |